

ECR #: P10

Tracker #: 14

Status: Ratified

Title: Rail Bumper Dimension Incorrect in Figure 3.7

Release Date: July 25, 1997

Impact, Medium: Possible Impact to Current Motherboard and Rail Designs

Spec Version: NLX 1.2

Summary:

The measurement given as 2.5" (63.5mm) from zone A to zone B incorrectly points to the top of the keepout zone B. The correct measurement is from the bottom of zone B.

Background:

Because of a drawing error in Figure 3.7, the measurement marking for the rail bumper keepout erroneously appears to point to the top of zone B. The corrected figure below is consistent with Figures 3.3 and 3.5, which specify the distance to the bottom of zone B.

Change Current Specification As Shown:

Replace Figure 3.7 with the following figure:

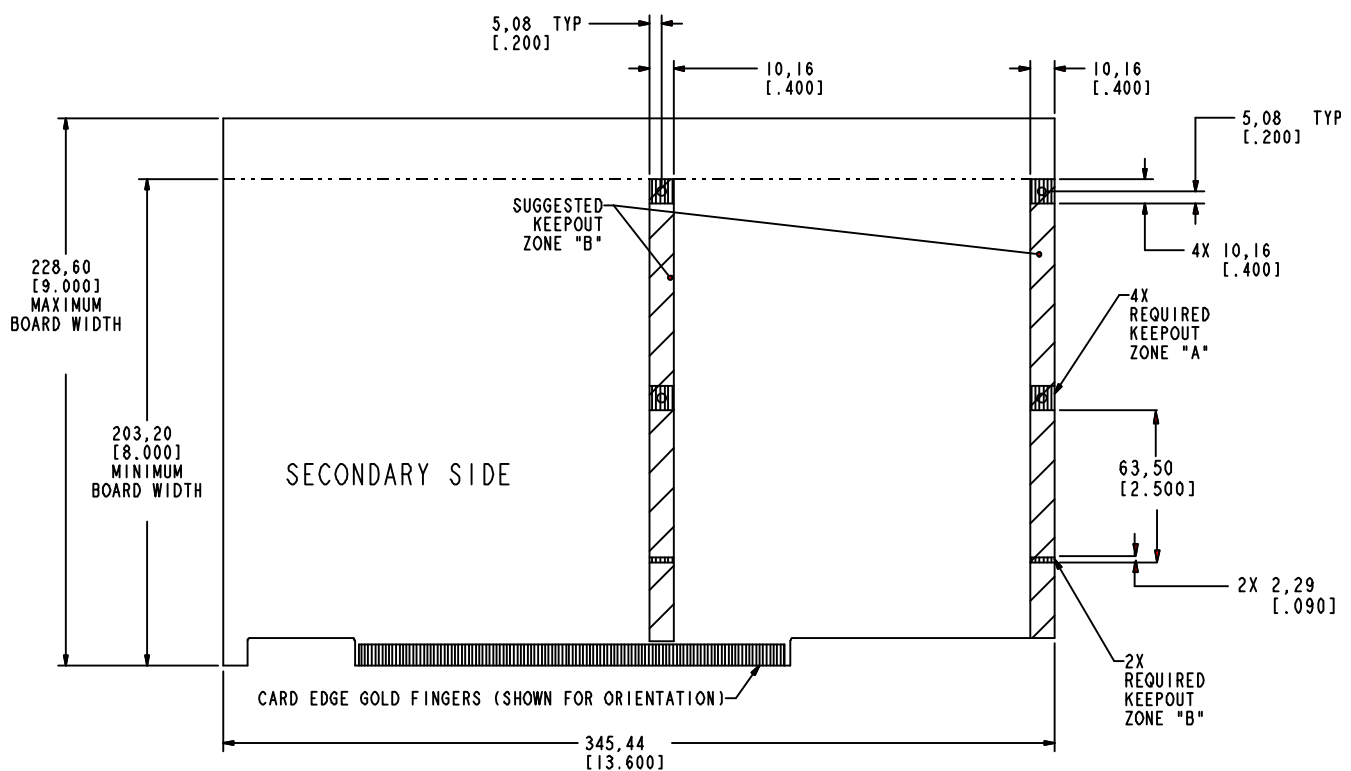


Figure 3.7: NLX Motherboard Dimensions—13.6 inches Secondary Side